



## WORK ORDER #: WO157562



## EMERGENCY SERVICE

**Address:** 415 Ambassador Dr., Mississauga ON L5T 2J3

**Toll-free:** 1 (866) 601-1758 | **F:** (905) 625-0187 | **E:** [service@northerndocksystems.com](mailto:service@northerndocksystems.com)

### Customer Information

Bermondsey Road  
Toronto, M4A 1X4  
ON, Canada

**Phone Number**

### Service Location





Steelwell Rd  
Brampton, L6T 5L9  
ON, Canada

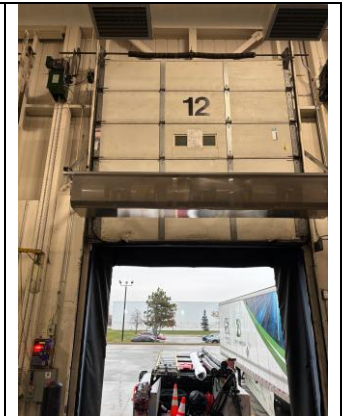
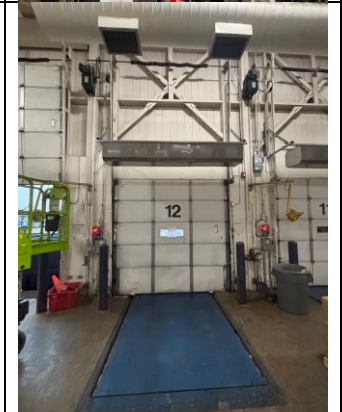
**Contact**  
Karl

### Service Details

<b>Created</b>	11/25/2025 7:34 AM	<b>Last Updated</b>	11/25/2025
<b>Type</b>	Local Service	<b>Priority</b>	
<b>Status</b>	Completed	<b>Last Visit Date</b>	11/25/2025
<b>Next Step</b>	No Action Required – internal	<b>Field Specialist</b>	Daniel
<b>Primary Incident Type</b>	Door Service	<b>Signed By</b>	Kevin
<b>Customer Asset</b>	Position 12 - Sectional Overhead Door	<b>P.O #</b>	TBD
<b>Scope of Work</b>	<p>Door 12 - cables have come off No lift on site - approved to order one. Door is down.</p> <p>*Main receiving door*</p>		

## Execution Notes

	Details	Content
<p><b>Created On:</b> 11/25/2025 3:42 PM</p> <p><b>Created By:</b> Daniel</p>	<p>Arrived on site and checked in with customer and manager. Proceeded to door 12. Found both cables off and frayed badly.</p>	
<p><b>Created On:</b> 11/25/2025 3:43 PM</p> <p><b>Created By:</b> Daniel</p>	<p>D 12 Replace both cables</p>	
<p><b>Created On:</b> 11/25/2025 3:45 PM</p> <p><b>Created By:</b> Daniel</p>	<p>D 12 Installed cables found limits not working properly</p>	
<p><b>Created On:</b> 11/25/2025 3:47 PM</p> <p><b>Created By:</b> Daniel</p>	<p>D 12 Found limit nut out of adjustment and limits assembly loose. Had to remove limits and control panel to tighten limits bracing and then reset limits.</p>	

<p><b>Created On:</b> 11/25/2025 4:31 PM</p> <p><b>Created By:</b> Daniel</p>	<p>D 12 Test and set limits ok in open position.</p>	
<p><b>Created On:</b> 11/25/2025 4:32 PM</p> <p><b>Created By:</b> Daniel</p>	<p>D 12 Tested door close, all working fine. Completed.</p>	
	<p><b>The equipment is functioning correctly. Job completed.</b></p>	